


## PGT<sup>®</sup> 120 Personnel Grounding Tester

( Part No.: 7100.PGT120 )

- The Personnel Grounding Tester PGT<sup>®</sup> 120 is a wrist strap and footwear tester for access control of ESD protected areas (EPA)
- The test result is indicated with audible and visual signals. A relay with a dry contact provides the connection to a door opening system
- Power supply: Internal battery or external power supply unit
- Wrist strap, right and left shoe testing is simultaneously possible by separate measuring circuits
- In combination with a barrier gate, the footwear measurement can be performed in series **without** pressing a button (hands-free mode).
- Separate measurement of left and right shoe
- Lower limit disabling is possible
- The unit can be used on bench tops or as a wall mounted unit (Wall mounting requires an additional wall mounting plate)

### Limit values and measure mode:

	Measuring range / Test voltage	Standard
Wrist strap / coil cord	750 k $\Omega$ - 35 M $\Omega$	IEC 61340-5-1
Footwear worn on metal plate (values for each shoe)	(100 k $\Omega$ *) - 35 M $\Omega$ <u>or</u> (100 k $\Omega$ *) - 70 M $\Omega$ * lower limit <i>can be disabled</i>	IEC 61340-5-1
Footwear in series	140 M $\Omega$ <u>or</u> 70 M $\Omega$ (both shoes in series)	---
Test voltage (without load)	100V/DC <i>changeable to 50V or 30V</i>	IEC 61340-5-1

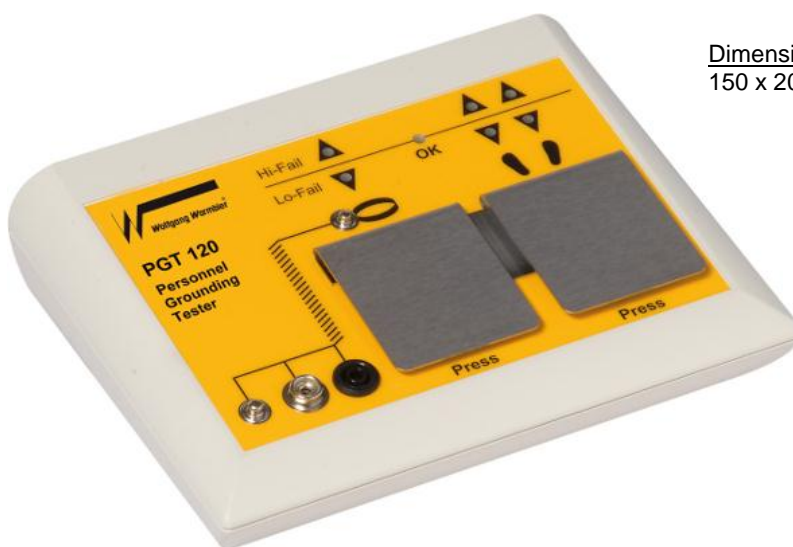

Dimensions:  
150 x 200 x 65 mm

### Supplied with:

- Footwear electrode,
- Power supply 240 V AC,
- 9 V battery
- Manual and calibration certificate (German/English)



Picture: Footwear electrode for separate shoe testing (350 x 500 x 8 mm)



- ▶ 1 year limited warranty
- ▶ Recommended calibration interval: 2 years

## Technical Information

Page 2 of 2

**Part No.:** 7100.PGT120




Certified by DQS  
ISO 9001:2008



**Wolfgang Warmbier**<sup>®</sup>  
Systeme gegen Elektrostatik

◆ Untere Gießwiesen 21 ◆ 78247 Hilzingen ◆ Tel.: +49-7731-86880 ◆ Fax: +49-7731-868830

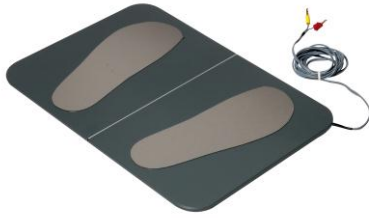

### **Footwear electrode**

Simultaneous left- and right shoe testing

### **Footwear and wrist strap test**

Simultaneous footwear and wrist strap test



### **Hands-free-Mode**

Footwear test without pressing a button

### **Accessories (optional):**

- Wall Mounting Plate Part No. 7100.PGT120.WK
- Calibration Unit for PGT<sup>®</sup>120 Part No. 7100.PGT120.CU
- Mat for footwear electrode with yellow bevelled edges Part No. 7100.PGT120.SM



ASRAS CO.,LTD  
1694, 1694/1 Prachasongkhro Road  
Dingdaeng, Dindaeng, Bangkok 10400  
Tel. 02-277-9969  
E-mail : sales@asras.co.th  
Website : www.asras.co.th

Distribution in Thailand by ASRAS Co.,Ltd.

We believe all the information in these pages including technical data to be reliable. However we make no warranties expressed or implied and assume no liability regarding any use of this information.